Trouble shooting Techniques Intraskan DC- IW

Errors and Warnings

When in a fault state, the unit would display an error message with a corresponding error code as defined here.

General Note: Power Recycling:-After switching OFF the Unit wait at least for 5 min before restarting the

Power.

Table 7-1: Error Codes

ERROR CODE	ERROR DETAIL
CN001	Communication Error
CN002	Console & Tube head incompatible
CN003	X Ray Preparation (Prep) time out
CN004	Anode Arc Fault
CN005	Cathode Arc Fault
CN006	Over kV Fault
CN007	Over mA Fault
CN008	kV Regulation Fault
CN009	Filament Open Fault
CN010	Filament Limit Fault
CN011	CAN Fault
KB001	Key Jam Error

SLI#	OBSERVED PROBLEM	Error details	RECOMMENDED ACTION
1	Error state with display indicating CN001	Communication Error: As soon as power ON MASTER USB scanner occurs then immediately error CN001.	Cold check(power OFF condition) with all boards connected and base unit ID opened. Step1:-Check end to end continuity of 10 core cable connectors Pin 7 &pin 8 ,If found open /measuring more than 10 ohm /either pin 7 or pin 8 shorted to ground, Replace 10 core cable. If the problem exists still check next step. Step2:- Check continuity between RJ45(either J4 or J5 of daughter board) cable connectors for Pin1& 2 , if found open / measuring more than 45 ohms/ either pin 1 or 2 shorted to GND in RJ45. Replace corresponding RJ45 cable. If the problem exists still check next step. Step3:-Replace internal console.
2	Error state with display indicating CN002	Console & Tube head incompatible. This error never reported at customer site. Possibility of occurrence is only during replacement.	Recycle the power. Retry to give exposures. Check the firmware compatibility matrix provided by tech support. If the problem persists, replace the Console first & if problem still persists then replace control board. If the Control board is replaced the Tube head has to undergo recalibration.
3	Error state with display indicating only CN003	Prep Time out Controller on the TH interrupted X-ray command after PREP command execution.	 Step1:-Recycle the power. Give the Exposure. If the problem exists still check next step. Cold check(power OFF condition) with all boards connected and base unit ID opened. Step 2:-Check end to end continuity of 10 core cable connectors pin 3,pin 9,pin10. If found open/ measuring more than 10 ohms /either pin 3 or pin 9 or pin 10 shorted to GND .Replace 10 core cable. If the problem exists still check next step. Step 3:Check end to end continuity of all 6 pins of RJ45 cable for power board(J4) to daughter board(PB). If found open /measuring more than 10 ohm /either pin 1 or 2 or 3 shorted to GND in RJ45.Replace RJ45 cable . If the problem exists still check next step. Step 4:Connect internal console directly to the J4 of power board(By passing daughter board) switch ON the unit try to give exposure, if unit works fine replace daughter board otherwise go to next step. Step 5:Switch OFF the unit and remove back ID of internal console board(J4). If found open / measuring more than 10 ohm / either pin1 or pin 2 or pin 3 shorted to GND .Replace cable. If the problem exists still check next step. Step 5:Switch OFF the unit and remove back ID of internal console board(J4). If found open / measuring more than 10 ohm / either pin1 or pin 2 or pin 3 shorted to GND .Replace cable. If the problem exists still check next step. Rear occurrence:- Replace the power board and if still problem persists, then replace control board. Note: If the Control board is replaced the Tube head has to undergo recalibration.
3a	Abort / Set time and actual time don't match	X-ray command terminated.	 Step1:-Recycle the power. Retry to give the Exposure with ensuring exposure switch pressed till it completes . If the problem exists still check next step. Step 2:-Switch OFF the unit,keeping exposure switch pressed & hold and switch ON the unit.KB001 error should appear in the console. If error occurs exposure switch found to be OK.If not replace exposure switch. If the problem exists still check next step. Step 3:-Check end to end continuity of 10 core cable connectors pin 3,pin 9,pin10.If found open/ measuring more than 10 ohms /either pin 3 or pin 9 or pin 10 shorted to GND .Replace 10 core cable.
4	Error state with display indicating CN004	Anode Arc Fault:	Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:Check end to end continuity of 10 core cable for pin4 ,pin5,pin6.If Pin 4,pin5 & pin6 open / measuring more than 10 ohms / either pin4 or pin5 shorted to GND .Replace 10 core cable.If the problem exists still check next step. Step 3:- Calibrate the unit as per procedure the problem exists still check next step. Rear occurrence:- Replace the Tube head .

5	Error state with display indicating CN005	Cathode Arc Fault:	Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:- Check end to end continuity of 10 core cable for pin4 ,pin5, pin6.If Pin 4,pin5 & pin6 open / measuring more than 10 ohms / either pin4 or pin5 shorted to GND .Replace 10 core cable.If the problem exists still check next step. Step 3:- Calibrate the unit as per procedure the problem exists still check next step. Rear occurrence:- Replace the Tube head .
6	Error state with display indicatingCN006	Over kV Fault	Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:-Check end to end continuity of 10 core cable for pin4 ,pin5, pin6.If Pin 4,pin5 & pin6 open / measuring more than 10 ohms / either pin4 or pin5 shorted to GND .Replace 10 core cable.If the problem exists still check next step. Rear occurrence:- Replace control board of theTube head . If the problem exists still replace tube head. Note: If the Control board is replaced the Tube head has to undergo recalibration .
7	Error state with display indicatingCN007	Over mA Fault	Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:-Calibrate the tube head. Rear occurrence:- Replace control board the Tube head . If the problem exists still replace tube head. Note:-If the Control board is replaced the Tube head has to undergo recalibration.
8	Error state with display indicatingCN008	KV Regulation Fault:	 Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:-Check continuity of INV power cable(3 way), measuring more than 10 ohm / any of wires shorted to GND .Replace INV power cable. Step 3:-Check end to end continuity of 10 core cable for pin4,pin5,pin6,pin9.If Pin 4,pin5 ,pin9 pin 6 open,/ measuring more than 10 ohm/ Pin 4,pin5 ,pin9 shorted to GND .Replace 10 core cable. Step 4:- (a) Ensure that there is no loose connection at the Input power source between the plug and socket. (b) Check the mains input voltage, it should be within specified tolerance limits.Check the power connections all the way till the Power board. (c) Ensure no loose connection of all cables. (d) Give Exposure at 4mA, 0.20secs and check whether the error is observed only at higher mA, then recalibrate the unit. [Please note that if the Unit works at lower mA and if the error is observed only at higher from the power source loose connection as indicated above.] (e) Ensure the RJ45 (6P6C) cable from the power to and 14 should be connected at the 'PB' connector on daughter board and console cable is connected to J5 of daughter board. If the connections are swapped there is a chance of CN008 error. After correcting the connections the power to the Unit has to be recycled once. Step 5:-Remove base ID cover ,set 4mA, 2secs .Press exposure switch till PREP command completes.Measure voltage at test points P380V & PGND in the power board.This voltage should be 370V-410V DC.If the measured voltage is less, following parts to be replaced one by one in the given order below:- Console along with cable RJ45 cable between power board & daughter board. Daughter board. Power board. Power board.
9	Error state with display indicatingCN009	Filament Open Fault	Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:-Calibrate the tube head. Rear occurrence:- Replace control board the Tube head . If the problem exists still replace tube head.

10	Error state with display indicatingCN010	Filament Limit Fault	Step1:-Recycle the power. Retry to give the Exposure. If the problem exists still check next step. Step 2:-Calibrate the tube head. Rear occurrence:- Replace the Tube head .
11	Error state with display indicatingCN011	CAN communication fault:	Step1:-Recycle the power. Clean the contacts of the Console connector Spiral chord. Retry to give exposure. If the problem persists, replace the console. Step 2:-Check end to end continuity of 10 core cable connectors Pin 7 &pin 8 ,If found open /measuring more than 10 ohm /either pin 7 or pin 8 shorted to ground, Replace 10 core cable. If the problem exists still check next step. Step3: Check end to end continuity of RJ45 cables, console cables, if found ok replace the console. Rear occurrence:- Replace the control board. Note: If the Control board is replaced the Tube head has to undergo recalibration .
12	Error state with display indicating KB001	Key JAM error	Step1:-Ensure that none of the console keys or exposure switch depressed accidentally. Recycle the Power. Step 2:-If the problem persists replace the console or exposure switch.
13	The unit does not power on when mains is switched on.	Mains fuse blown/No DC bus voltage.	 Step1:-Remove the Base Unit Top cover. Is there any loose contact at the wall socket end or the wall outlet is not receiving power. Check local electrical circuit for trips. Check if neon pilot lamp is ON in the power board. If neon lamp is ON then check the following:- Ensure that the cable connection to the base Unit is proper. Recycle the power. Step 2:-If the problem persists replace the console. Step 3:-If the problem persists replace the power Board.
14	No x-ray image even though the unit indicates normal exposure	KV, mA values mismatch	Ensure the set kV, mA values matches with feedback values displayed on the console. Ensure that there is no error in the console. If ok then check the image receptor used.
15	Tube Head Hot	Tubehead heated up due to prolong usage	Step1:-In Unit OFF condition, remove the control board wait for some time to cool and reconnect it back. If the problem exists still check next step. Step2:-Replace tube head.

Power board (301-000012-1) Indication details.




DC voltage Neon lamp


Control board (301-000010-1) Indication details.



Console Extension PCB-INTERNAL (301-000340-0) Indication details.

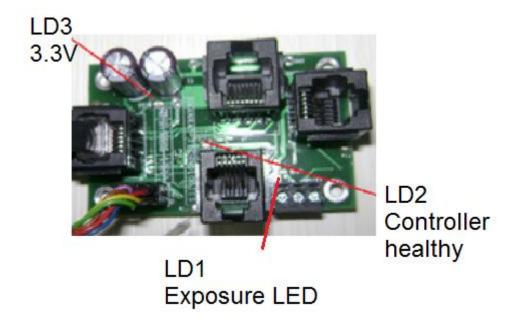

Door bell switch (301-000340-1) Indication details.

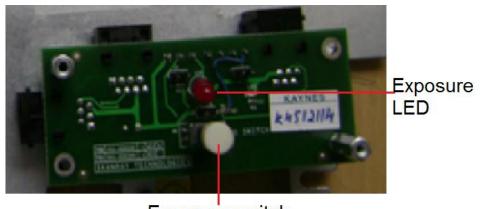

Exposure switch